

# PROCES VULKANIZACIJE SILEN BLOKA U KOMPANIJI VORWERK

Hristina Aćimović<sup>1</sup>, dr Andelija Mitrović<sup>2</sup>

[hristinaacimovic95@gmail.com](mailto:hristinaacimovic95@gmail.com), [andjelija.mitrovic@vstss.com](mailto:andjelija.mitrovic@vstss.com)

## REZIME

Vulkanizacija je hemijski proces koji poboljšava gumu, čineći je elastičnijom i otpornijom na toplotu, hemikalije itd. Proizvod dobijen procesom vulkanizacije služi za bezbednost vozila, udobnost i umanjenje mehaničkih i zvučnih efekata u vožnji. Nalazi se u prednjem i zadnjem vešanju i služi za montažu polušasije. Svrha rada je detaljan prikaz brizganja gume u silent blok (lager). U radu su objašnjene akcije koje su preduzete radi rešavanja problema, konkretno, neulivenosti gume u lager. Usled neulivenosti gume došlo je do ekstremne reklamacije kupca, koja je proizvela dodatne troškove firmi Vorwerk Autotec Serbia d.o.o.

**Ključne reči:** guma, vulkanizacija, mašina, operater, alat.

## PROCESS OF VULCANIZATION OF SILENT BLOCK IN VORWERK COMPANY

### ABSTRACT

Vulcanization is a chemical process that improves rubber, making it more elastic and resistant to heat, chemicals, etc. The product obtained by the vulcanization process serves for vehicle safety, comfort and reduction of mechanical and sound effects while driving. It is located in the front and rear suspension and serves to mount the half chassis. The purpose of the paper is a detailed description of rubber injection into a silent block (bearing). The paper explains the actions that were taken to solve the problem,, specifically, that the rubber was not poured into the bearing. As a result of the rubber not being cast, there was an extreme complaint from the customer, which produced additional costs for Vorwerk Autotec Serbia d.o.o.

**Key words:** rubber, vulcanization, machine, operator, tool.

## 1. UVOD

Guma je mehanički čvrst i izvanredno elastičan materijal koji se dobija od kaučuka postupkom vulkanizacije. To je materijal koji se može reverzibilno deformisati u širokom temperaturnom intervalu.

Vulkanizacija je proces koji gumi, usled termičke obrade, daje bogatiju strukturu, veću elastičnost i promenu tvrdoće, u zavisnosti od tehničkih zahteva. Guma koja nije prošla proces vulkanizacije, zapravo, nije čvrsta, ne povlači se suštinski u prvočitan oblik nakon velike deformacije, i može biti veoma lepljiva.

Vulkanizacija poboljšava fizičke osobine bilo koje prirodne ili sintetičke gume, što rezultira jačom gumom, većom elastičnošću na velikim temperaturama, kao i većom otpornošću na bubrenje i habanje. Vulkanizacijom se dobija nepovratan proces očvršćavanja elastomera.

---

<sup>1</sup>Vorwerk Autotec Serbia d.o.o., Čačak

<sup>2</sup>Fakultet tehničkih nauka, Svetog Save 65, Čačak

## 2. PROIZVOD DOBIJEN PROCESOM VULKANIZACIJE

Firma Vorwerk je nemačka firma koja se bavi proizvodnjom auto delova koji obezbeđuju sigurnost, udobnost i dinamičnost vozila. Iz širokog asortimana izdvajaju se lageri koji se ugrađuju u prednje i zadnje vešanje, i služe za montažu polušasije. Neki od najvećih kupaca su Tesla, BMW, Daimler, Volvo, Volkswagen i mnogi drugi.

Kroz rad će biti prikazan jedan od delova, tj. lager koji prolazi kroz razne faze procesa u proizvodnji. Na primeru su prikazane pozicije ugradnje lagera u zadnje vešanje Porsche-a 911 (slika 1 i 2).



Slika 1: Pozicije ugradnje lagera u zadnje vešanje Porsche-a 911



Slika 2: Pozicija lagera kod vešanja

Lageri, pored bezbednosti, udobnosti i dinamičnosti, umanjuju i mehaničke i zvučne efekte u vožnji.

Proces proizvodnje jednog lagera polazi od sečenja (cutting-a), savijanja komponenata (bending-a), premazivanja komponenata radi lepljenja gume (coating-a), vulkanizacije (ulivanje gume), finalizacije, (kalibriranje) itd.

U ovom radu će detaljnije biti opisan proces vulkanizacije lagera (slika 3), zajedno sa procesom rešavanja problema koji je usledio reklamacijom kupca.



*Slika 3: Lager (silen blok)*

### **3. PROIZVOD DOBIJEN PROCESOM VULKANIZACIJE**

Proces vulkanizacije se sastoji iz više delova, tj. koraka. Za početak, neophodno je pripremiti mašine za rad. Na proces vulkanizacije gume se može preći nakon uverenja da je sve spremno za početak istog.

Dat je prikaz zatvorenog alata u DOUSH mašini (slika 4) tokom procesa vulkanizacije. U samom podnožju, ispod ploča, može se videti cilindar koji vrši pritisak tokom vulkaniziranja. U zavisnosti od oznake mašine, zavisiće i koliki će biti pritisak utiskivanja.




*Slika 4: Zatvoren alat u DOUSH mašini*

Nakon završetka vulkanizacije, alat se otvara. Ploča FT2 se spušta i kreće ka Operateru 1. Kada FT2 ploča dolazi u krajnju poziciju do Operatera 1, aktivira se MAGIC BOX koji se pozicionira iznad FT2 ploče i skuplja ulivke sa nje (slika 5). Operater 1 pomoću LOADING BOARD-a skuplja ostatak gume.



Slika 5: MAGIC BOX skuplja ulivke

Za sve to vreme, FT3 ploča dolazi na poziciju izbijanja lagera, kreće se suprotno od FT2 ploče na zadnju stranu mašine. Pomeranje ploče (slika 6) posmatra se sa leva na desno.

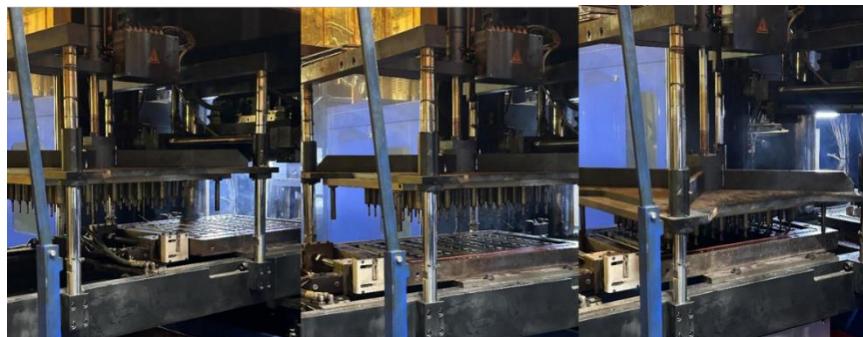

Slika 6: Pomeranje FT3 ploče radi izbijanja lagera

Izbijeni lageri ispadaju na pokretnu traku, koja vodi delove u konvejer koji dostavlja delove do Operatera 2. Operater 2 na mašini za vulkanizaciju gume, zadužen je za proveru kvaliteta delova prema control plan-u i prema radnim instrukcijama.

Delovi se transportuju do stola Operatera, kasnije Operater 2 preuzima delove, nakon što ih traka izbací iz mašine. Ukoliko traka stoji, zabranjeno je ulaziti u mašinu i samostalno uzimati delove sa trake.

Kada proizvedeni delovi sa transportne trake dospeju na sto, Operater 2 vrši čišćenje delova od viška gume i vizuelnu kontrolu kvaliteta proizведенog dela. Operater proverava delove prema control plan-u. Takođe, treba da izvrši i vizuelnu ocenu kvaliteta delova prema katalogu grešaka.

U toku smene, Operater 2 popunjava dokumentaciju koja je za dati projekat predviđena control plan-om i projektnom dokumentacijom. Takođe, u toku smene na MES terminalu popunjava sve predviđene podatke, prema postojećim instrukcijama.

Kontrola kvaliteta proizvedenih delova se vrši pomoću kataloga OK/NOK delova. Nakon vizuelne provere, Operater 2 izvršava proveru kilaže lagera tako što postavlja lager na vagu za merenje težine, čime se izvršava verifikacija težine delova (slika 7).




Slika 7: Prikaz merenja lagera na vagici

Ako se na vagici pojavi zeleno svetlo, to znači da je lager u toleranciji i ide u OK deo. OK delovi se smeštaju u GITTER BOX.

#### 4. EKSTERNA REKLAMACIJA


Kupac Beycelk Gestemb Chassiss je prijavio neizliven deo (slika 8). Potrebno je vizuelno proveriti da li je deo u potpunosti izliven sa obe strane lagera.

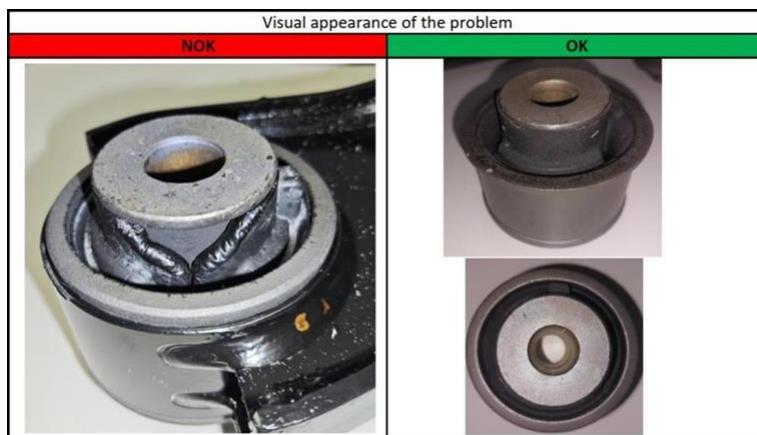

Slika 8: Vizuelni prikaz neulivenog dela

## 4. 1. Uzrok neulivenosti gume

Alat poseduje 5 tool tempova (TT). Došlo je do pogrešnog povezivanja creva na TT sa alatom na zoni gde se nalaze dizne. Do ovoga je došlo jer operater nije imao obeležena creva sa oznakama „ULAZ/IZLAZ“. Iz tog razloga se smatra da je došlo do zamene creva na TT. Pogrešnim povezivanjem creva, poremećen je tok ulja u alatu, a samim tim i temperature, što je dovelo do vulkanizacije dizni, i kasnije do neulivenih delova. Preuzeta akcija, u ovom slučaju, je postavljanje oznaka na crevima. Pravilna oznaka creva „ULAZ/IZLAZ“ prikazana je na sledećoj slici (slika 9).

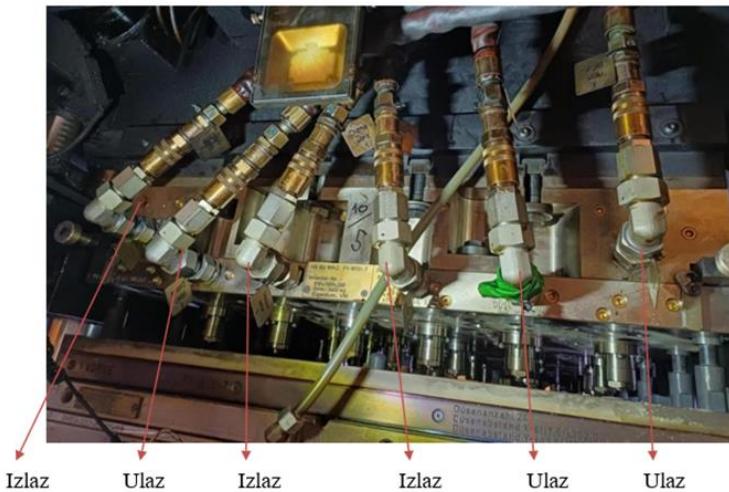

Slika 9: Prikaz pravilne oznake creva „ULAZ/IZLAZ“


## 4. 2. Dokaz o povezivanju creva TT

Na sledećoj slici (slika 10) je tabelarno prikazano pod rednim brojem 4970 – Dokaz o realizaciji postavljanja kartica na creva TT.

REDNI BROJ	DATUM	MODEL	MESEC	GOVORNA	TIP aviona	OPIS ALATA	BRD NALOGA	POGON	Vrste	PR GORENJAČA / generacija / interenacije	Aluminijus servisa	Dostave intervencij	Vreme prevozovanja	Vreme stvarne intervencije	AKTIVIRANJE / VODSTVUJUĆI NEKTAK	POMERANA, OFIS / Amerika Istraž.	USLUDZENI DELOVI	FATRACIJSKI BROJ	DRUGAČIJA *	NAPOMENA	TOČKA
4																					
8421	3433	28-02-23	13	32	2023	Premet avion	FAZNZO	A3436/23	Plastič	Vravnički	intervencija_ALE_01_Električni kabl				FAZLE	1.50 Preveriti napravljenu popravku na dinamiku. Ustvari provodi 13 dana sa grednjem i sondačem. Od tega pet dana su napravljene 6 popravki. Brzina					
8571	3584	13-02-23	3	1	2024	Vulka, avion	FAZNZO	A3436/24	Vravnički	intervencija_ALE_01_Električni kabl				FAZLE	2.50 Preveriti napravljenu popravku na dinamiku. Ustvari provodi 13 dana sa grednjem i sondačem. Od tega pet dana su napravljene 6 popravki. Brzina						
2996	4037	20-02-24	8	2	2024	Vulka, avion	FAZNZO	A3436/24	Vravnički	intervencija_ALE_01_Električni kabl				FAZLE	3.00 Preveriti napravljenu popravku na dinamiku. Ustvari provodi 13 dana sa grednjem i sondačem. Od tega pet dana su napravljene 6 popravki. Brzina						
1213	4231	20-02-24	8	2	2024	Vulka, avion	FAZNZO	A3436/24	Plastič	Vravnički	intervencija_ALE_01_Električni kabl			FAZLE	3.50 Preveriti napravljenu popravku na dinamiku. Ustvari provodi 13 dana sa grednjem i sondačem. Od tega pet dana su napravljene 6 popravki. Brzina						
1241	4231	20-02-24	8	2	2024	Vulka, avion	FAZNZO	A3436/24	Vravnički	intervencija_ALE_01_Mehanička LR				FAZLE	3.50 Preveriti napravljenu popravku na dinamiku. Ustvari provodi 13 dana sa grednjem i sondačem. Od tega pet dana su napravljene 6 popravki. Brzina						
5202	5128	29-02-24	17	8	2024	Vulka, avion	FAZNZO	A3436/24	Plastič	Vravnički	intervencija_ALE_01_Mehanička LR			FAZLE	3.50 Preveriti napravljenu popravku na dinamiku. Ustvari provodi 13 dana sa grednjem i sondačem. Od tega pet dana su napravljene 6 popravki. Brzina						

Slika 10: Dokaz o obeležavanju creva TT

Prikaz realizacije, tj. obeležene dizne prema datoj instrukciji je prikazan u nastavku (slika 11).

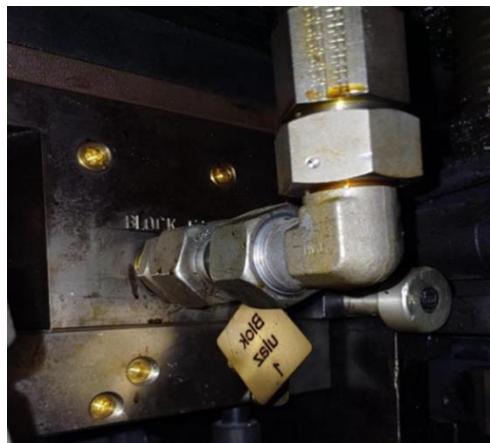

Slika 11: Pločica za obeležavanje dizni

#### 4. 3. Spisak BREAK POINT-a

Spisak BREAK POINT-a je dat u nastavku (slika 12).

Akcije koje su preduzete	Datum break point-a
Obeležavanje creva TT/HK	10.04.2024.
Sproveden alarm kvaliteta	31.05.2024.
Reobuka OP2	06.06.2024.
Obuka za instrukciju za tačkanje (sprovedena u sklopu reobuke OP2)	06.06.2024.
Instrukcija za tačkanje lagera izvršena	05.06.2024.
Aktiviranje tačkanja delova	07.06.2024.
Odobrenje od kupca za tačkanje delova	06.06.2024.

Slika 12: Tabelarni prikaz Break Point-a

#### 5. PROBLEM SOLVING SHEET

Dokument za rešavanje internih i eksternih reklamacija dat je u nastavku (slika 13). Sa ovim dokumentom se zaključuje reklamacija.

Problem solving sheet			No.:
Problem description: Nedovoljen deo Plant/dep./workshop: Vulk.ka Line/station: M570-13 Product/component: 19138 Date, time: 31.05.2024. Shift: 1st Employee: n/a Process leader: Mirko Božičevan Goličić			
<b>1. Definition of the problem</b> Description: The problem is The problem is not What exactly is the problem? Nedovoljno izliven deo Kubikača gume Where exactly does the problem occur? Na vrtu IK se pojavila neuvlknost Neuvlknost se nije pojavila između IK i AS When exactly did the problem occur? Prilikom sortiranja od strane TRIGO kompanije Problem nije učen na novi vulkanizacijski vaučerom kontrolom OP2 How often did the problem occur? <b>2. Facts analysis</b> Root cause analysis (containing technical and systematical)			
Root cause analysis (containing technical and systematical) No. Containment action (prevent problem being passed on) Responsible Date/time Status 1 Postavljanje Q alarme D. Tatović/Trenert 31.05.2024. A 2 Sortiranje kod Triqa A. Stoković/Inst 30.05.2024. A			
<b>3. Containment</b> 			
<b>4. Root cause analysis</b> Cause-and-Effect Diagram (Cause: Technological and Systematic)			
<b>5. Planned Actions</b> No. Root cause Actions Responsible Deadline Status 1 1 Rešenja OP2 za vizuelnu kontrolu. D. Tatović/Trenert 31.05.2024. A 2 2 Rešenja OP1 za pravilno održavanje alata. D. Tatović/Trenert 18.06.2024. A 3 3 Uvođenje tačanja lagera - instrukcija za tačanje D. Tatović/Trenert 06.06.2024. A 4 5			
<b>6. Implemented Actions</b> No. Root cause Actions Responsible Deadline Status 1 1 Rešenja OP2 za vizuelnu kontrolu. D. Tatović/Trenert 31.05.2024. A 2 2 Rešenja OP1 za pravilno održavanje alata. D. Tatović/Trenert 18.06.2024. A 3 3 Uvođenje tačanja lagera - instrukcija za tačanje D. Tatović/Trenert 06.06.2024. A 4 5			
<b>7. Standardization</b> Control plan, FMEA, Work instruction, Check list etc. Resp. Deadline Problem applicable to other process, products (Vokalen) Resp. Deadline Reason if no standard is altered/changed: Reason if no yokoten is necessary: Teamleader: Team:			
<b>8.</b>			

Slika 13: Problem Solving Sheet

## 6. ZAKLJUČAK

Automobilska industrija predstavlja globalnog lidera u vidu obima proizvodnje i standardizacije. Najstrožiji zahtevi za sigurnost krajnjeg korisnika i same proizvodnje su vezani za automobilsku industriju. Podatak koji opravdava sve navedeno predstavlja broj nastradalih osoba na godišnjem nivou, a na prvom mestu te liste jeste automobilski saobraćaj.

Svi procesi proizvodnje u automobilskoj industriji, pa i sama vulkanizacija, moraju sprovoditi mere koje propisuje IATF 16949 standard, kako bi se broj nastradalih svake godine smanjivao sve više i više.

U ovom radu detaljno je prikazan i definisan proces vulkanizacije, postupak izrade proizvoda, rad alata, mašine i uloga dokumentacije u celom procesu. Sve navedeno predstavlja samo deo koji je potrebno ispuniti kako bi se osigurao kvalitet, dug vek proizvoda, a samim tim povećala sigurnost krajnjeg korisnika.

Vulkanizacija predstavlja samo jedan od procesa koji pripada automobilskoj industriji. Poseban akcenat u procesu vulkanizacije mora se postaviti na operatore. Ukoliko svest i obučenost operatera nije na adekvatnom nivou, lako može da dođe do njihove povrede, propusta u radu koji dalje dovodi do internih i eksternih reklamacija, što podiže troškove kompanije.

## **7. LITERATURA**

1. Horvat, Z. *Tehnologija gume*. Udruženje preduzeća za industriju gume FNRJ, 1960.
2. Vulcanization, Science Direct.  
<https://www.sciencedirect.com/topics/materials-science/vulcanization>
3. Radne instrukcije – uputstva. Vorwerk, Autotec Serbia, 2018.
4. Hofmann, W. *Rubber technology handbook (2nd ed.)*. Hanser Publishers, 1996.
5. Gent, A. N. *Engineering with rubber: How to design rubber components (2nd ed.)*. Carl Hanser Verlag GmbH & Co. KG, 2012.
6. Gent, A. N. *Vulcanization and the properties of elastomers*. John Wiley & Sons, 1992.